

Technical Bulletin

Subject: TR-7 and Alpine IVA-D900 Date: May 20, 2003

Problem: The TR-7 does not overide the video safety feature on Alpine's IVA-D900.

Cause: Alpine's yel/blk footbrake input wire does not have enough load on the TR-7 blue wire resulting in a slight voltage from the TR-7, which simulates that the foot brake is never released.

Fix: Take a 2000 ohm resistor and connect one end of the resistor to the blue wire of the TR-7 as shown below. Connect to other end of the resistor to ground.

